

Work Order ID 102938

\*102938\*

Page 1

June-12-13 9:17:05 AM

Item ID: D212-664-201

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Aft

Start Date: 6/11/13 Start Qty: 1.00

\*1\*

Cust Item ID:

Required Date: 6/11/13 Req'd Qty: 1.00

\*1\*

Customer:

Reference:

Approvals: Process Plan: MLJ

Date: 13-06-13

Tooling:

Date:

Run Start \*NR1\*

QC:

Date:

SPC (Y/N):

Date:

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D212-664-241

Rev D (DEO)

DSI9563

B

100

\*100\*

DC

Document Control

DOCUMENT CONTROL

Memo

Photocopy bluefile and create labels as per PPP D212-664-201

0.00

0.00

(DAS 06 2-23) 13/6/29

CHG005

① HJ for MLJ 13-7-26

110

\*110\*

Packaging

Packaging

Pick Kit

Packaging

Memo

0.00

0.00

Ln 13-07-03

PTO

DQA:

Date:

13/08/06

## WORK ORDER NON-CONFORMANCE / UPDATE

DART  
AEROSPACE

QA Closed:

Date:

13/8/11

Work Order update only ☐

Work Order: <u>102938</u>	<b>DISPOSITION</b> Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input checked="" type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>			
Part No. <u>D212-664-201</u>		Skid-tube <input type="checkbox"/>	Crosstube <input checked="" type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>
NCR No. <u>13-2893</u>		Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>
		Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>
		Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling	13/7/8	120	1	CRUSHING IS OVER TOLERANCE.	UP 13/7/8	Acceptable per attached S.R.	UP 13/7/8	DAS 16 9-89	DAS 16 9-89
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

## FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--	--

# Work Order ID 102938

**\*102938\***

Page 2

June-12-13 9:17:05 AM

Item ID: D212-664-201

Accept

**\*N9000040100\***

Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Aft

Start Date: 6/11/13 Start Qty: 1.00 **\*1\***

Cust Item ID:

Required Date: 6/11/13 Req'd Qty: 1.00 **\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120		0.00							
<b>*120*</b>	BENDING MACHINE - CROSSTUBES								
CNC Bend 2	Memo	0.00							
CNC Alpha 160 Bender	Bend tube as per Dwg D212-664-241 using CNC bender program 212-aft								
130	QC15- Crosstube Dimensional Check	0.00							
<b>*130*</b>									
QC	Memo	0.00							
Quality Control									

*977m.L*  
*13/07/09*

*DAS*  
*16*  
*9-83*  
*13/07/09*

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other
--	--	---	--

# Work Order ID 102938

\*102938\*

Page 3

June-12-13 9:17:05 AM

Item ID: D212-664-201

Accept

\*N9000040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Aft

Start Date: 6/11/13 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 6/11/13 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start \*NR1\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

140

0.00

\*140\*

Crosstubes

0.00

Crosstubes

Memo

1-Drill pilot holes in tube as per Dwg D212-664-241 using drill Jig DT8550, DT8551, drill table DT8577 and locate tower holes #8 as per QS10010.

2-Ream hole to finish size in tube as per Dwg D212-664-241 using drill Jig DT8550 & DT8551. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.

3-Scribe part # and batch # using vibrating stylus as per Dwg D212-664-241

4- \*\*\*WEAR LATEX GLOVES HANDLIND CROSSTUBE \*\*\* Debur & Inspect for surface damage. Repair damage within limits as per Dwg D212-664-241

JW 13-07-09

EB 13-07-10  
JW

150

QC5- Inspect part completeness to step on W/O

0.00

\*150\*

0.00

QC

Memo

\*\*\*WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE\*\*\*

Quality Control

Sub  
13.7.11

1

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other  _____ _____ _____
--	--	---	---

# Work Order ID 102938

**\*102938\***

Page 4

June-12-13 9:17:05 AM

Item ID: D212-664-201

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Aft

Start Date: 6/11/13 Start Qty: 1.00 **\*1\***

Cust Item ID:

Required Date: 6/11/13 Req'd Qty: 1.00 **\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

160

0.00

**\*160\***

HandFXTube

Memo

0.00

Hand Finishing Crosstubes

\*\*\*WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE.\*\*\*

1- CLEAN CROSSTUBE WITH WASH'N WIPE

1 0 0 13-7-11

180

Outsource process - NDT per QSI038 4.1

0.00

**\*180\***

Outsource2

Memo

0.00

Outsource process - NDT

\*\*\*WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE.\*\*\*

Liquid Penetrant Inspection as per QSI 038

Issue P/O: 20557

LPI as per ASTM 1417 Level 2

Attach copy of NDT results to work order

13-07-11

190

Receive & Inspect for Damage & Mat'l Certs

0.00

**\*190\***

Packaging

Packaging

Memo

0.00

Packaging

\*\*\*WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE.\*\*\*

Ensure copy of NDT results attached to work order.

13-7-11

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other
--	--	---	--



# Work Order ID 102938

\*102938\*

Page 5

June-12-13 9:17:05 AM

Item ID: D212-664-201

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Aft

Start Date: 6/11/13 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 6/11/13 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Run Start \*NR1\*

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Stop \*NR2\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

200

QC5- Inspect part completeness to step on W/O

0.00

\*200\*

QC

Memo

0.00

Quality Control

\*\*\*WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE.\*\*\*

Inspect for damage & ensure results are as per Dwg D212-664-241

DAJ  
05  
13-07-12

204

Crosstubes Chemical Conversion

0.00

\*204\*

HandFXtube

Memo

0.00

Hand Finishing Crosstubes

\*\*\*WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE.\*\*\*

1- PRESSURE WASH AND THEN USE WASH'N WIPE TO CLEAN CROSSTUBE BEFORE CHEMICAL CONVERSION

90D 13-07-11  
D

206

QC7-Inspect Chemical Conversion Coat

0.00

\*206\*

QC

Memo

0.00

Quality Control

\*\*\*WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE.\*\*\*

DAJ  
05  
13-07-12

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other _____ _____ _____
--	--	---	---

**Work Order ID 102938****\*102938\***

Page 6

June-12-13 9:17:05 AM

Item ID: D212-664-201

Accept

**\*N9000040100\***Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Aft

Start Date: 6/11/13

Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 6/11/13

Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals:

Process Plan: \_\_\_\_\_

Date: \_\_\_\_\_

Tooling: \_\_\_\_\_

Date: \_\_\_\_\_

Run Start **\*NR1\***

QC: \_\_\_\_\_

Date: \_\_\_\_\_

SPC (Y/N): \_\_\_\_\_

Date: \_\_\_\_\_

Stop **\*NR2\***Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID

Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

210

Spray Painting per QSI005 4.2

0.00

**\*210\***

SprayPaint

0.00

SprayPaint

Memo

Spray Painting

\*\*\* WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE\*\*\*

1	0	0	AB
13-7-22			

1-Prime inside and outside crosstube as per QSI 005 4.2

PRIME BATCH: 124403Start Time: 8:00Fininsh Time: 9:00

\*\*\*MASK UNDERSIDE OF CROSSTUBE AS SHOWN ON DWG DEO\*\*\*

2-Paint outside crosstube with White Imron as per QSI 005 4.2

PAINT BATCH: 125986Start Time: 5:45Finish Time: 6:30

3- Remove masking and apply matte clear coat as per dwg DEO

CLEAR BATCH: 123770

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

# Work Order ID 102938

\*102938\*

Page 7

June-12-13 9:17:05 AM

Item ID: D212-664-201

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Aft

Start Date: 6/11/13 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 6/11/13 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start \*NR1\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
220	QC14- Inspect Spray Paint	0.00							
*220*									
QC	Memo	0.00							
Quality Control	Then, Wrap in plastic bag to protect from scratches								
230		0.00							
*230*	Crosstubes								
Crosstubes	Memo	0.00							
Crosstubes	1-Abrade mating surfaces of support and crosstube with 180 grit sandpaper, clean the area with MEK or equivalent as per dwg								
	2-Install supports with Proseal 890 per D212-664-241 (DEO) and QSI 015								
	A/R Proseal 890 Batch: 126010								
	EXP: 2/14								
	3-Install supports clamps Using Dt9565 as per Dwg D212-664-241 (DEO), Torque to 80-100 IN-LBS.								
	PROSEAL CURE TIME 72 HOURS:								
	Start: 6:22								
	Finish: 7:07								

DAS  
05  
9-89 13-07-21

13-7-21

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

Work Order ID 102938

\*102938\*

Page 8

June-12-13 9:17:05 AM

Item ID: D212-664-201

Accept

\*N9000040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Aft

Start Date: 6/11/13 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 6/11/13 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start \*NR1\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

240 QC5- Inspect part completeness to step on W/O 0.00

\*240\*

QC

Quality Control

Memo

0.00

\*\*\*RE-CHECK TORQUE ON CLAMP AFTER PROSEAL HAS CURED  
FOR 72HOURS AS PER DWG.\*\*\*

1

DAS  
05  
9-83 13-07-25

250 Pick Kit 0.00

\*250\*

Packaging

Packaging

Memo

0.00

1

13-07-26 JB

260 QC4- 100% Inspect kits for completeness 0.00

\*260\*

QC

Quality Control

Memo

0.00

13/7/29

DAS  
06  
9-83

1

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--



# Work Order ID 102938

\*102938\*

Page 9

June-12-13 9:17:05 AM

Item ID: D212-664-201

Accept

\*N9000040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Aft

Start Date: 6/11/13 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 6/11/13 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start \*NR1\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
270		0.00							
*270*	Packaging	0.00				13/7/30		51	8
Packaging	Memo	0.00							
Packaging	Identify and pack for shipping as per PPP D212-664-201								
280	QC21- Final Inspection - Work Order Release	0.00							
*280*		0.00							
QC	Memo	0.00							
Quality Control									

13/7/31

13-07-30

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

# Picklist Print

June-12-13 9:17:05 AM

Page 1

Work Order ID: 102938  
Parent Item: D212-664-201  
Parent Item Name: Crosstube Aft

Start Date: 6/11/13

Required Date: 6/11/13

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:E04.02.16ReformatK/DS  
IPP Rev:F 06-03-29 Remove Coments on Pick List JLM  
IPP Rev:G 07-04-30 As per Rev C JLM  
IPP Rev:H 08-05-22 up date Qty of rubber cushion DD verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D212-664-201TRNRevC Crosstube Turning Detail		Manufactured	No			110	Each	0.0000	1	1			
D3595-063-530 RUBBER CUSHION		Manufactured	No	B101941 103099		230	Each	127.0000	2	420		Rm 13-07-03 13-7-22	
			<u>Location</u>			<u>Loc Qty</u>	<u>Loc Code</u>						
			FG			5							
			82656			5							
			LG051			97							
			63407			6							
			67185			6							
			70067			18							
			72745			2							
			75783			7							
			79932			13							
			82656			10							
			87833			5							
			90969			21							
			99914			9							
			ST414			25							
			101880			25							
D2940-1 Support		Manufactured	No			230	Each	36.0000	2	2		13-7-22	
			<u>Location</u>			<u>Loc Qty</u>	<u>Loc Code</u>						
			LG052			36							
			100710			20							
			71829			1							
			90677			2							
			93038			1							
			96803			12							

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

# Picklist Print

June-12-13 9:17:05 AM

Page 2

Work Order ID: 102938  
Parent Item: D212-664-201  
Parent Item Name: Crosstube Aft

Start Date: 6/11/13

Required Date: 6/11/13

Start Qty: 1.00

Required Qty: 1.00

MS21920-28  
Clamp(per MIL-DTL-8783C)

Purchased No

230 Each 117.0000

4

4

13-7-22

## Location

## Loc Qty

## Loc Code

FG 5  
105884 5  
LG 50  
M125728 50  
LG050 47  
123674 14  
124505 4  
125351 29  
LG051 15  
121440 8  
123243 2  
124260 5

Manufactured No

250 Each 28.0000

## Location

## Loc Qty

## Loc Code

ST045 28  
100704 28

Purchased No

250 Each 421.0000

## Location

## Loc Qty

## Loc Code

ST314 421  
123248 9  
125535 412

Purchased No

250 Each 0.0000

Purchased No

250 Each 98.0000

## Location

## Loc Qty

## Loc Code

ST517a 98  
124561 23  
125388 75

D3428-1  
Placard

MS21042E6  
Nut

AN960JD616  
Washer

AN6-40A  
Bolt

June-12-13 9:17:05 AM

Shop Packet Print

Page 2

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%; border: none;"> <tr> <td style="width:25%;">Skid-tube <input type="checkbox"/></td> <td style="width:25%;">Crosstube <input type="checkbox"/></td> <td style="width:25%;">Water Jet <input type="checkbox"/></td> <td style="width:25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

# Picklist Print

June-12-13 9:17:05 AM

Page 3

Work Order ID: 102938  
Parent Item: D212-664-201  
Parent Item Name: Crosstube Aft

Start Date: 6/11/13

Required Date: 6/11/13

Start Qty: 1.00

Required Qty: 1.00

AN6-41A  
Bolt

Purchased

No

250

Each

68.0000

2

2

20 13-07-26

SL

## Location

## Loc Qty

## Loc Code

ST340

18

124561

18

ST517

50

125388

50

125388

June-12-13 9:17:05 AM

Shop Packet Print

Page 3

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									


### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other  _____ _____ _____
--	--	---	---



DART AEROSPACE LTD		Work Order:	102938
Description: Crosstube High Aft (205/212)		Part Number:	D212-664-201
Inspection Dwg: D212-664-241 Rev: D		Page 1 of 1	

Required Dimension	Min	Max
Height	24.17	24.43
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.70
Bending Passes	5	--
Crushing	--	6%

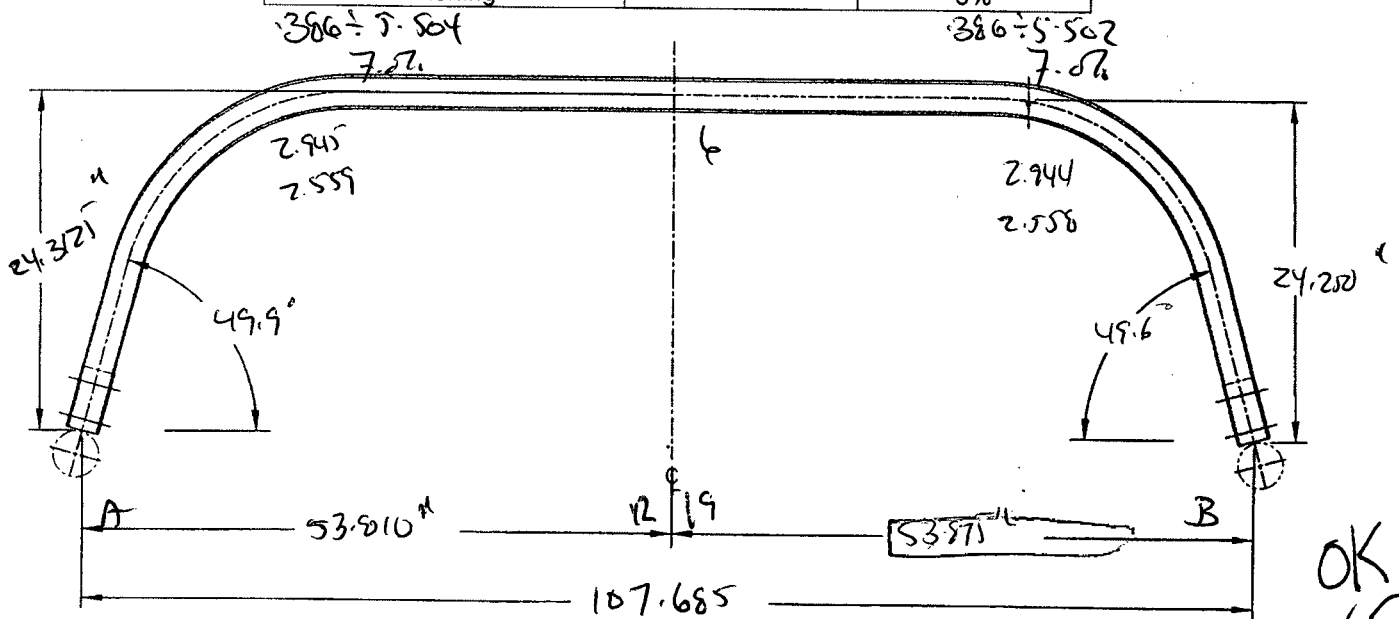

	Side A	middle	Side B
Bending Passes	12	6	19
Crushing	7.02		7.02
Comments			
Side A = 7.02 crushing @ 12 Passes			
middle = 6 Passes			
Side B = 7.02 crushing @ 19 Passes			

QC15 Inspection	DAS
Date	16 9-89 13/07/09

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	07.05.08	Dimensions updated per Dwg rev. C	KJ/JLM	
C	10.04.01	Dwg Rev updated	KJ	
D	12.04.16	Added bending, crushing dimensions	KJ	



Item	Qty -241	Qty -241B	Part Number	Description
1	X		D212-664-241	CROSSTUBE ASSEMBLY (205/212 HIGH AFT)
2		X	D212-664-241B	CROSSTUBE ASSEMBLY (214 HIGH AFT)
3	1	1	D6006-129	CROSSTUBE
4	2	2	D2940-1	SUPPORT
5	4	4	D3595-063-530	RUBBER CUSHION
6	4	4	MS21920-28	CLAMP (OR MS21920-30)
7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

# **GENERAL NOTES:**

- 1) MATERIAL: MANUFACTURED FROM D6006-129  
FINISHED LENGTH = 124.362±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF  
USING VIBRATING STYLUS.
- 7) WEIGHT: D212-664-241 = 44.2 lbs (PER IIN-D212-664)  
D212-664-241B = 44.2 lbs (PER IIN-D212-664)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 5 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING  
IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2940-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE  
OF D2940-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS  
AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-28 CLAMPS (OR -30) WITH D3595-063-530 RUBBER CUSHIONS TO SECURE THE D2940-1  
SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE  
SUPPORT.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE  
SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR  
DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND  
MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT  
HAS NOT BOTTOMED-OUT AFTER TORQUING.

600 #11-614  
11.08.25

UNDER REVIEW

01/06/13

102938 ML5

13-06-13

DEO ATTACHED

RELEASED  
2009-10-29

D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -241B (ZN D4-2, B4-2); REMOVED REF & ADD TOLERANCES (ZN D8-3 & C4-3, C6-3 & A8-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -1009 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF	DRAWING NO.	REV. D
CHECKED	PH	D212-664-241	SHEET 1 OF 4
MFG. APPR.	PH	TITLE	SCALE
APPROVED	PH	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DE APPR.	PH	COPYRIGHT © 2006 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	
DATE	09.09.30		



102938

12 13 15  
D2940-1 SUPPORT  
MS21920-28 CLAMP, 2X  
D3595-063-530 RUBBER CUSHION, 2X  
2 PL

A5-2

A

14.00 (-241)  
OR 13.75 (-241B)

D

D212-664-601  
BENT TUBE

SYM

**D212-664-241/-241B**  
**ASSEMBLY DETAIL**

D

600 #11-614  
11.07.26

UNDER REVIEW

4/11/06.15

DEO ATTACHED

**RELEASED**  
2009-10-28

12  
APPLY MAGNOBOND  
BETWEEN D2940-1 AND  
CROSSTUBE

D2940-1 SUPPORT, REF

13 15  
MS21920-28  
CLAMP, REF


D3595-063-530 RUBBER CUSHION  
UNDER CLAMP, REF

**SECTION A-A** D6-2  
SCALE 4X


DESIGN	PH	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	98	DRAWING NO.	REV. D
MFG. APPR.	15	D212-664-241	SHEET 2 OF 4
APPROVED	12	TITLE	SCALE
DE APPR.	14	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	




102938

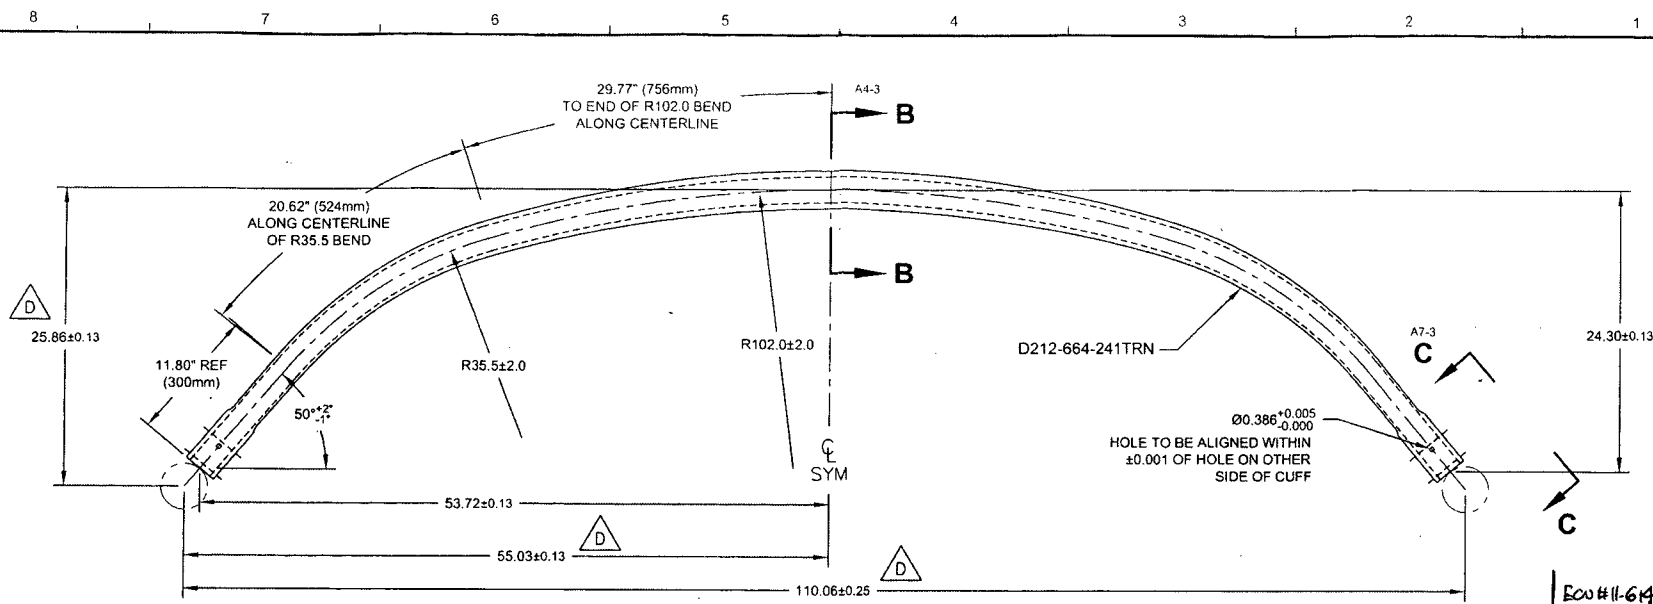

**D212-664-601** 10 D  
**BENDING AND DRILLING DETAIL**

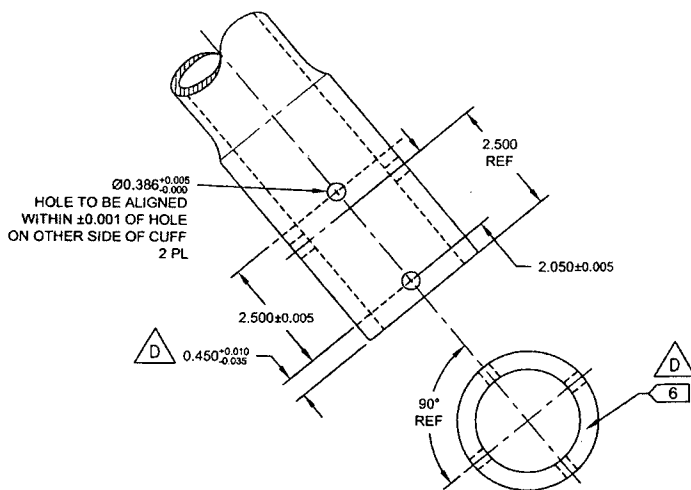

**VIEW C-C: CUFF DETAIL** D2-3  
 SCALE 3X

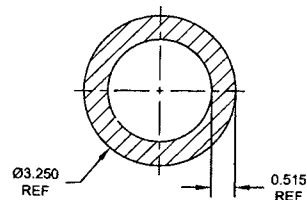

**SECTION B-B** D4-3  
 SCALE 4X

ECU #11-614  
 10.07.28

**UNDER REVIEW**  
09/11/2009

**DEO ATTACHED**


**RELEASED**  
 2009-10-28  
*MD*

DESIGN	<i>PH</i>	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>Q</i>	DRAWING NO.	REV. D
MFG. APPR.	<i>JS</i>	D212-664-241	SHEET 3 OF 4
APPROVED	<i>MD</i>	TITLE	SCALE
DE APPR.	<i>MD</i>	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2005 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD</small>	





102938

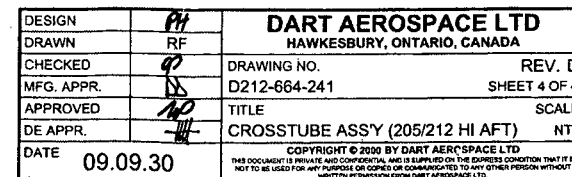

RELEASE  
2009-10-29

M

**DART AEROSPACE LTD**  
HAWKESBURY, ONTARIO, CANADA

DRAWING NO.	REV. D
D212-664-241	SHEET 4 OF 4
TITLE	SCALE
CROSSTUBE ASSY (205/212 HI AFT)	NTS

COPYRIGHT © 2000 BY DART AEROSPACE LTD  
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS  
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT  
WRITTEN PERMISSION FROM DART AEROSPACE LTD



102938

DRAWING NO. D212-664-241	TITLE CROSSTUBE ASSY (205/212 HI AFT)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-241-D-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED		MFG. APPR.		APPROVED	DE APPR.	
DATE 11.04.07	DATE 11.04.11		DATE 11.04.12		DATE 11/04/12	DATE 11.04.12	

**PURPOSE:**

ADD AN INSPECTION WINDOW TO UNDERSIDE OF CROSSTUBE.

**CHANGE:**

NOTES 2 OF SHEET 1 IS AMENDED AS FOLLOWS:

**IS:**

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND  
PAINT OUTSIDE PER DART QSI 005 4.2  
REMOVE MASKING AND APPLY CLEAR COAT

**WAS:**

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2

RELEASED  
2011-04-18

UNDER REVIEW

11.06.13

ECN#11-614

11.07.20




102938

DRAWING NO. D212-664-241	TITLE CROSSTUBE ASSY (205/212 HI AFT)	REV. D	<b>DART AEROSPACE LTD ENGINEERING ORDER</b>	D.E.O. NO. D212-664-241-D-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED <i>CP</i>	MFG. APPR. <i>E</i>	APPROVED <i>MD</i>	DE APPR. <i>MD</i>		
DATE 11.04.07	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12		


IS:

WAS:

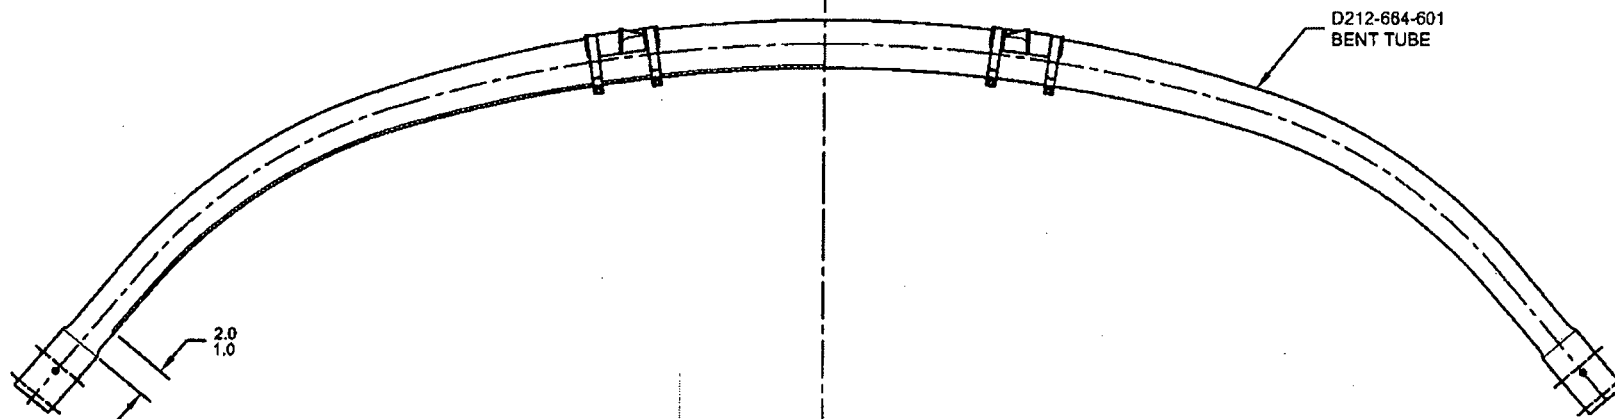

**D212-664-241/-241B  
ASSEMBLY DETAIL**

MASK AREA PRIOR TO PAINTING,  
REMOVE MASKING AFTER PAINT  
AND APPLY CLEAR COAT

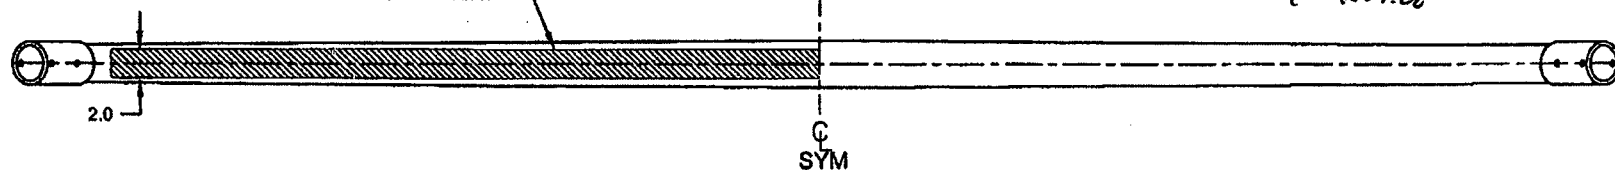

**RELEASED**  
2011-04-18

**UNDER REVIEW**

*CP* 11.06.13  
DOW #11.04.12  
11.07.28

**COPYRIGHT © 2011 BY DART AEROSPACE LTD**  
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS  
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT  
WRITTEN PERMISSION FROM DART AEROSPACE LTD.



102938

DRAWING NO. D212-664-241	TITLE CROSSTUBE ASS'Y (205/212 HI AFT)	REV. D	<b>DART AEROSPACE LTD ENGINEERING ORDER</b>		D.E.O. NO. D212-664-241-D-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN 92	CHECKED ASS	MFG. APPR. 8	APPROVED MP	DE APPR. H			
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11/27/21	DATE 11-07-21			

**PURPOSE:**

REPLACE MAGNOBOND WITH PROSEAL.

**CHANGE:**

IS:

Item	Qty -241	Qty -241B	Part Number	Description
7	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2940-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2940-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2940-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

**RELEASED**  
2011-07-28  
W





# DART SERVICE INSTRUCTION

TO AMEND INSTRUCTIONS FOR CONTINUOUS AIRWORTHINESS ICA-D212-664 Rev. 6 OR LATER

REF. CANADIAN STC: SH01-9  
REF. FAA STC: SR01298NY  
REF. EASA STC: EASA.IM.R.S.01304

## PURPOSE:

The supports on the following crosstubes are now installed using Proseal instead of Magnobond:

D212-664-101/-101B @ CHG 005  
D412-664-105 @ CHG 002  
D212-664-107/-107B @ CHG 002

D212-664-201/-201B @ CHG 005  
D212-664-207/-207B @ CHG 002

102938  
13-06-13  
MJS

## CHANGE:

For the crosstubes listed above, section 32.4 of ICA-D212-664 is amended as follows. Use Figure 1 of this service instruction and Figures 32-2 to 32-9 of ICA-D212-664 for further reference. For crosstubes of an earlier change number, it is recommended that if the supports are removed, the supports should be reinstalled using the procedure listed below.

## 32.4 SUPPORT INSTALLATION



- 32.4.1 Locate the area on the crosstube for installation of support (see Figure 1 of this service instruction). For D212-664-101/-107/-201/-207 and D412-664-105 crosstubes, the outward face of the support tabs should be 14.0" (355mm) from the crosstube center for 204/205/210/412/UH-1 aircraft. For installation on 214B/B-1 aircraft, the outward face of the support tabs should be 13.75" (349mm). Ensure paint finish of crosstube is intact; touch up as required per Chapter 5 (5.3.9) of ICA-D212-664.
- 32.4.2 If present, remove any paint/primer on bottom of supports. Abrade mating surfaces of support and crosstube with 400-grit sandpaper. Saturate a clean cloth with MEK or 4105S Wash'n'Wipe Degreaser or equivalent and wipe until there is no residue.
- 32.4.3 Ensure a layer of 3M Scotch-Weld 2216 B/A Epoxy Adhesive is on the bottom of the support. If required, either apply or touch-up support to have a 0.03" to 0.05" thick layer of adhesive over the entire mating surface. Allow supports to cure for 24 hours.
- 32.4.4 Abrade mating surfaces of support (after cure) and crosstube with 180-grit sandpaper. Saturate a clean cloth with MEK or 4105S Wash'n'Wipe Degreaser or equivalent and wipe until there is no residue.
- 32.4.5 Apply a 0.04" to 0.07" thick layer of Proseal 890 Class B or AMS-S-8802 Class B sealant underneath applicable support and install support as shown in Figure 1 of this service instruction.
- 32.4.6 Install the clamps opposite to crosstube support as shown in section A-A of Figure 1. Install rubber cushions underneath each clamp around the bottom circumference of the crosstube up to the crosstube centerline. Torque clamps 80-100 in-lb (9.0-11.3 Nm). It is acceptable to use smaller or larger sized MS21920-XX clamps than those listed in ICA-D212-664, ensure that after torquing the clamps per this instruction, the nuts are in safety but not bottomed out
- 32.4.7 Prior to installing crosstube on aircraft, allow supports to cure for 72 hours and recheck torque on clamps.

CANADA  
DEPARTMENT OF TRANSPORT  
AIRCRAFT CERTIFICATION  
BRANCH  
DAO # 01-O-01


APPROVED

BY:   
D. SHEPHERD (DE # 02)

DATE: 11.07.20  
CERT. NO.: SH01-9  
ISSUE NO.: 3

B	ADD 3M 2216 ADHESIVE TO SUPPORT	CP	11.07.15
A	NEW ISSUE	CP	11.06.14
REV.	DESCRIPTION	BY	DATE
DESIGN	42	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
DRAWN	42		
CHECKED	ASS		
MFG. APPR.	N/A		
APPROVED			
DE APPR.		DRAWING NO. DSI 9563	REV. B SHEET 1 OF 2
DATE	11.07.15	TITLE SUPPORT INSTALLATION CHANGE	SCALE NTS
COPYRIGHT © 2011 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			



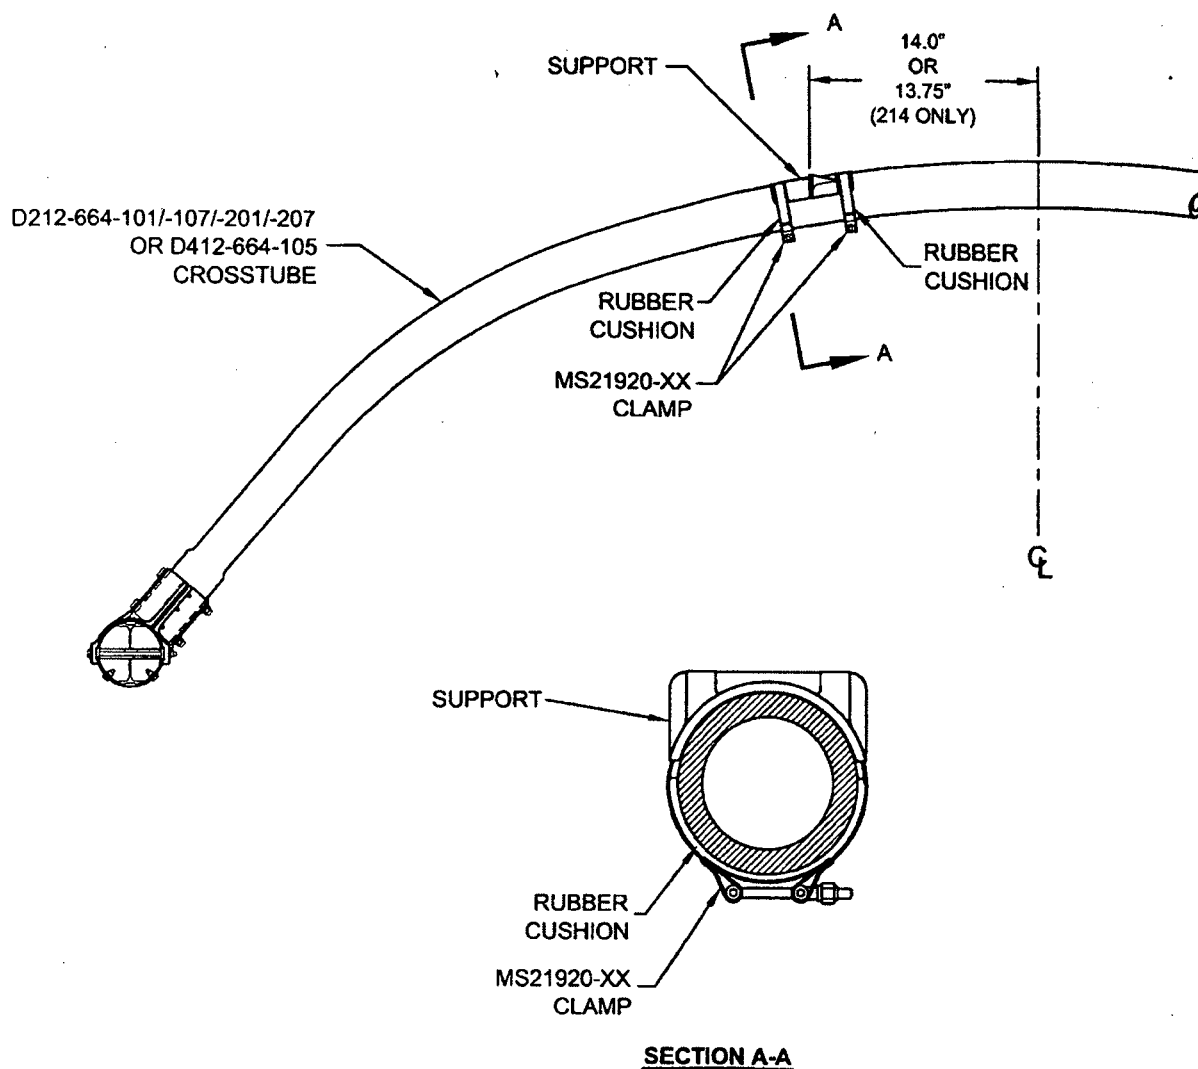

**FIGURE 1: SUPPORT INSTALLATION**

CANADA  
DEPARTMENT OF TRANSPORT  
AIRCRAFT CERTIFICATION  
BRANCH  
DAO # 01-O-01

APPROVED  
*[Signature]*  
BY: D. SHEPHERD (DE # 02)

DATE: 11.07.20  
CERT. NO.: SH01-9  
ISSUE NO.: 3


DESIGN	9	<b>DART AEROSPACE LTD</b>	
DRAWN	9	HAWKESBURY, ONTARIO, CANADA	
CHECKED	ASS	DRAWING NO.	REV. B
MFG. APPR.	N/A	DSI 9563	SHEET 2 OF 2
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	SUPPORT INSTALLATION CHANGE NTS	
DATE	11.07.15	COPYRIGHT © 2011 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

102938



# CRUSHING OF D212-664-201

Acceptability of 8% CRUSHING

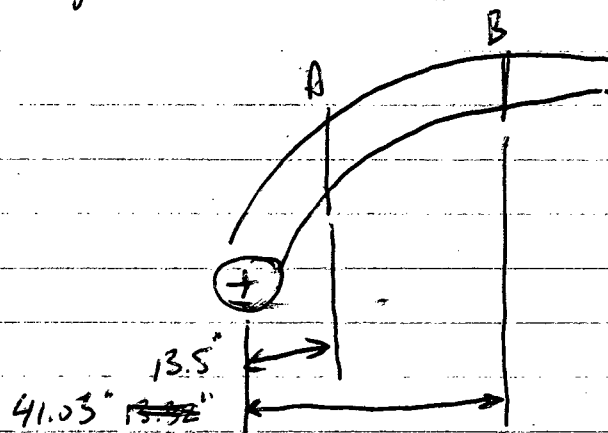

Point A:  $OD1 = 2.548 \text{ in}$   $OD2 = 2.992 \text{ in}$   
 $CRUSHING = (2.992 - 2.548) / (2.992 + 2.548) = 8\%$   
 $I = 1.476 \text{ in}^4$

Point B:  $OD = 3.25 \text{ in}$   $ID = 2.22 \text{ in}$   
 $I = 4.284 \text{ in}^4$

A:  $F = M/L/I = P \times 13.5 \times 2.548 / 2 \times 1.476 = 11.65 P$   
 B:  $= P \times 41.03 \times 2.992 / 2 \times 4.284 = 14.32 P$

$MS = 14.32 / 11.65 - 1 = 0.22$

Tube will fail at support before area of 8%  
 CRUSHING. 8% CRUSHING AT END OF BEND  
 IS ACCEPTABLE

P12.12.21





P-11995

HEURE AM ☒ PM ☐

DATE Jan 11 2013 HEURE \_\_\_\_\_  
N° TRAVAIL 188-13-CO2224  
ACUREN \_\_\_\_\_  
N° CLIENT POMO 20537

PROJECT Pt-wet Fluorescent Liquid penetrant Inspection  
ITEM(S) EXAMINED See Below

SITE DE TRAVAIL: As Address  
ACCEPTATION STD. Asm 4/17/05/232 DATE/RÉV. 2005

DESCRIPTION DES TRAVAUX	N° PROCÉDURE	LT-002	DATE/REV.	2009	N° TECHNIQUE	LT-002	DATE/REV.	2009
N° ITEMS	MATÉRIEL		S/S		ÉPAISSEUR		N/A	
DESCRIPTION	Performed a wet Fluo LPI on 100% of the external surface only on Items mentioned below							

MÉTHODE :	<input checked="" type="checkbox"/> FLUORESCENT	<input type="checkbox"/> VISIBLE	<input checked="" type="checkbox"/> LAVABLE À L'EAU	<input type="checkbox"/> MÉTHODE DISSOLVANT	<input type="checkbox"/> PRÉ-ÉMULSIONNANT
MARQUE :	Magne Flux		LUM. NOIRE S/N 13790	<input type="checkbox"/> PUISS. > 1000 µ W/CM²	<input type="checkbox"/> AMBIANT < 2 fc
PÉNÉTRANT :	ZL-67	TEMPS PÉNÉTRATION MIN.	45 MIN.	ÉQUIP. LUMIÈRE <input type="checkbox"/> LAMP. POCHÉ <input type="checkbox"/> LAMP. CULASSE	<input type="checkbox"/> PUISS. > 100 fc @ SURFACE
DISSOLVANT PÉNÉTRANT	Hg <sup>0</sup>	TEMPS SÉCHAGE MIN.	> 10 MIN.	AUTRES	
RÉVÉLATEUR	ZP-9F	TEMPS PÉNÉTRATION MIN.	30 MIN.	MÈTRE LUM. N/S 1098866	DATE CAL DUE oct 2017
TYPE RÉVÉLATEUR	<input checked="" type="checkbox"/> NON AQUEUX	<input type="checkbox"/> AQUEUX	<input type="checkbox"/> SEC		

CONDITION SURFACE	<input checked="" type="checkbox"/> MEULÉE	<input type="checkbox"/> Soudée	<input checked="" type="checkbox"/> MACHINÉE	<input type="checkbox"/> GRENAILLÉE	<input checked="" type="checkbox"/> MÉTAL PROPRE
TEMPÉRATURE SURFACE	<input checked="" type="checkbox"/> < 4°C/20°F	<input type="checkbox"/> 4°C/20°F DE 10°C/50°F	<input type="checkbox"/> 10°C/50°F DE 52°C/125°F	<input type="checkbox"/> > 52°C/125°F	

☐ MÉTRIQUE    ☐ IMPÉRIAL

ITEM	COMMENTAIRES	ACCÉPTÉ	REJETÉ	Item ID	Indications
1	Crosstube w.o ID 93986 (AH) ✓			0212-664-201	Ground once 1x o.k
2	Crosstube w.o ID 102932 (AH) ✓			0212-664-201	
3	Crosstube fwd High w.o ID 102956 ✓			0212-664-101	
4	Crosstube fwd-High w.o ID 103953 ✓			0212-664-101	Indications Ground once o.k
5	Crosstube fwd High w.o ID 102957 ✓			0212-664-101	
6	fwd crosstube-High w.o ID 103587 ✓			0212-664-101	

M/ 13-07-12

### Étendue des Services

L'entente selon laquelle le Groupe Acuren Inc. exécute les services ne concerne que les énoncés par écrit. En aucune circonstance ces services ne s'étendent au-delà de l'exécution des services demandés. Il est entendu que toutes les descriptions, les observations et les expressions d'opinions faites par Acuren reflètent les opinions ou les observations de l'entreprise fondées sur l'information et les hypothèses fournies par le propriétaire/opérateur, et elles ne constituent pas des déclarations ou des garanties ou ne peuvent être interprétées comme constituant. Le Groupe Acuren Inc. n'assume aucune des responsabilités du propriétaire/opérateur, et le propriétaire/opérateur conserve la responsabilité entière des décisions prises en matière d'ingénierie, de fabrication, de réparation et d'usage à partir de l'information ou des données fournies par Acuren en rapport avec les services décrits dans les présentes ne peuvent excéder le coût des services rendus.

## Norme de Diligence

Dans l'exécution des services, le Groupe Acuren Inc. applique le degré de diligence, le soin et la compétence normalement exercés dans des circonstances semblables par d'autres fournisseurs de ce type de services opérant dans la même localité ou dans une localité similaire. Aucune autre garantie, implicite ou explicite, n'est faite ou voulue par le Groupe Acuren Inc.

## SIGNATURES

REPRÉSENTANT Andy Sheldon  
MOULÉ

TECHNICIEN (SIGNATURE): Alexandre Michard

NOM (MOULÉ): Alexandre Michard  
1<sup>ER</sup> TECHNICIEN

GNGC NIVEAU 2 SNT NIVEAU 2  
GNGC N° REG. 10142

*Adhela*  
SIGNATURE

2<sup>ème</sup> TECHNICIEN

ONGC NIVEAU \_\_\_\_\_ SNT NIVEAU \_\_\_\_\_

ONGC N° REG. \_\_\_\_\_

FTJ# **F-07999**

RAPPORT  
RÉVISÉ PAR:

NOM	INITIALES
-----	-----------





## 5.0 PARTS LIST

## 5.1 HIGH GEAR CROSSTUBES

Item	-101	-201	-203	Part Number	Description
	X			D212-664-101	CROSSTUBE INSTALLATION, 204/205/210/212/214/412, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH FWD
		X		D212-664-201	CROSSTUBE INSTALLATION, 204/205/210/212/214, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH AFT
			X	D412-664-203	CROSSTUBE INSTALLATION, 412 HIGH AFT
1	1			D212-664-141	CROSSTUBE ASSEMBLY, 204/205/210/212/214/412, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH FWD
2		1		D212-664-241	CROSSTUBE ASSEMBLY, 204/205/210/212/214, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH AFT
3			1	D412-664-243	CROSSTUBE ASSEMBLY, 412 HIGH AFT
10	2			* D2893-1	SUPPORT
11	4			* D3595-063-450	RUBBER CUSHION
12	4			* MS21920-25	CLAMP (OR MS21042-26)
13	4			AN6-35A	BOLT
14	4			AN6-36A	BOLT
15	6			MS21042L6	NUT (OR MS21042-6)
16	18			AN960JD616	WASHER
20		2		* D2940-1	SUPPORT
21		4		* D3595-063-530	RUBBER CUSHION
22		4		* MS21920-28	CLAMP (OR MS21042-30)
23		4		AN6-40A	BOLT
24		2		AN6-41A	BOLT
25		6		MS21042L6	NUT (OR MS21042-6)
26		18		AN960JD616	WASHER
30			1	* D2896-1	SUPPORT
32			2	* D3595-063-570	RUBBER CUSHION
33			4	* MS21920-28	CLAMP
34			2	* MS21920-30	CLAMP (OR MS21042-32)
35			4	AN6-40A	BOLT
36			2	AN6-41A	BOLT
37			6	MS21042L6	NUT (OR MS21042-6)
38			18	AN960JD616	WASHER
39			2	* D3189-1	CHAFING SHIELD
50	1	1		D3428-1	PLACARD

\*REFERENCE ONLY. PARTS ARE INCLUDED IN D212-664-141/-241 OR D412-664-243 ASSEMBLIES ABOVE  
NOTE: KITS INCLUDE EXTRA HARDWARE FOR COMPATIBILITY WITH BOTH DART AND BELL/AAI  
SKIDTUBES.

